




the future is safer with altro




Altro Impressionist™ II / Altro IP20


Safety Flooring / Suelos de Seguridad / Sicherheitsbodenbelag

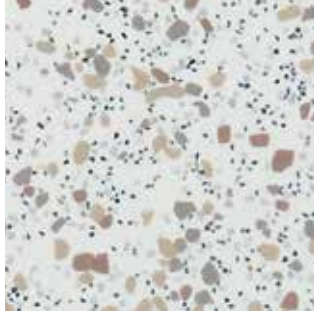


Stucco IP2013
WR105 / A1M1 / LRV 61

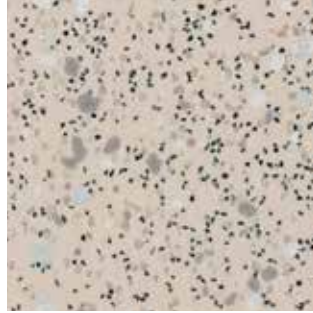


Canvas IP2009
WR12 / A1M12 / LRV 48

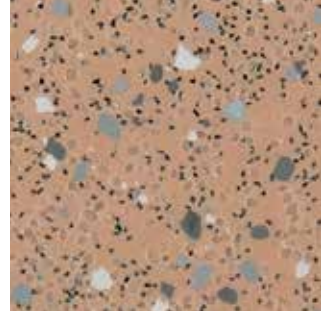


Adobe IP2008
WR24 / A1M27 / LRV 32

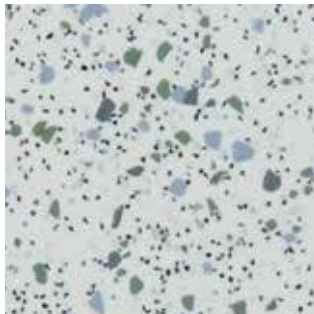


Oasis IP2011
WR136 / A1M136 / LRV 49

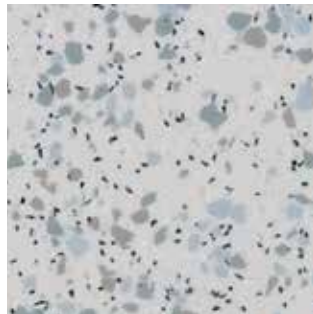


Arctic IP2012
WR11 / A1M11 / LRV 49

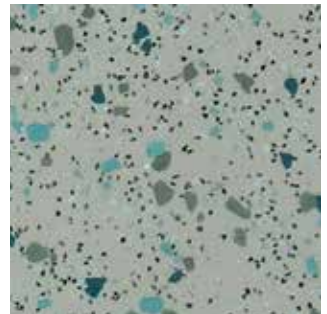


Zen IP2015
WR137 / A1M137 / LRV 34

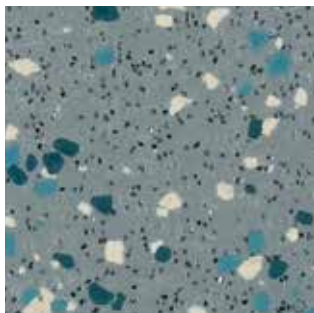


Ore IP2004
WR81 / A1M81 / LRV 26

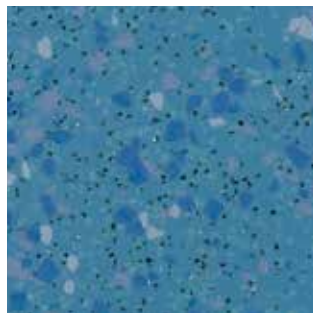


Tranquil IP2017
WR71 / A1M71 / LRV 21

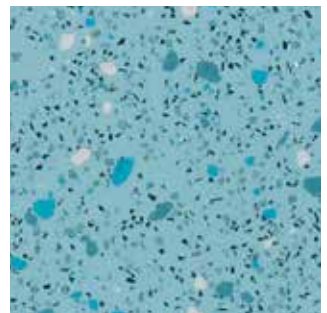


Aqua IP2018
WR135 / A1M135 / LRV 38

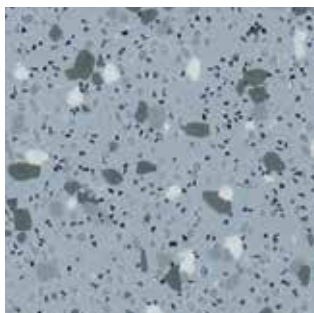

Lunar IP2005
WR85 / A1M85 / LRV 36

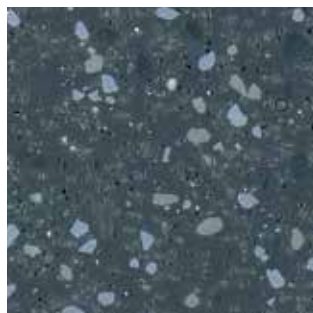

Mineral IP2003
WR83 / A1M83 / LRV 14

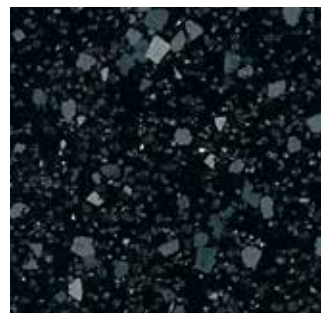

Ebony IP2001
WR100 / A1M100 / LRV 6

Light Reflectance Values measured in accordance with BS8493:2008. Exact material match with samples cannot be guaranteed.
No podemos garantizar que el material del suelo de seguridad coincide exactamente con el de las muestras. Eine exakte Übereinstimmung des Materials mit Mustern kann nicht garantiert werden.
Codes: **WR** = weld rod, **A1M** = mastic, **LRV** = light reflectance value. Códigos: **WR** = Cordon de soldadura, **A1M** = Mástique, **LRV** = Valor de reflectancia de la luz.
Abkürzungen: **WR** = Schweißschnüre, **A1M** = Altro Mastic Dichtmasse, **LRV** = Lichtreflexionswert



















Altro is the first safety flooring manufacturer to recycle traditional safety flooring in-house

A+ BRE generic green guide rating for safety flooring, full details available at www.thegreenguide.org.uk



Altro Impressionist™ II / Altro™ IP20 safety flooring

AKUK 08/15

Flooring type Tipo de pavimento Belagsart		EN 13845/ EN 13553	Safety flooring Suelo de seguridad antideslizante Sicherheitsbodenbelag
Classification for use Areas de uso Einsatzbereiche		EN 685	34 and 43 34 y 43 34 und 43
Slip resistance Resistencia al deslizamiento Rutschsicherheit*		TRRL EN 13845 EN 13893 DIN 51130	≥ 36 ESf DS R10
Thickness Espesor total Gesamtdicke		EN 428	2 mm
Flexibility Flexibilidad Flexibilität		EN 435	Pass Conforme bestanden
Wear layer Capa de uso Nutzschicht		EN 429	2 mm
Weight Peso Flaechengewicht		EN 430	2.6 kg/m ²
Roll dimensions Dimensiones del rollos Rollenabmessungen		EN 426	2 m x 20 m = 40 m ²
Light fastness Resistencia a la luz Lichtechtheit		EN 20105-B02	≥6
Sound insulation Aislamiento acústico Trittschal		ISO 140-8	5 dB
Wear resistance Abrasión Verschleißverhalten		EN 13845	≤10% particles lost over 50000 cycles ≤10% de las partículas perdidas en 50.000 ciclos ≤10% Partikel werden über 50000 Umdrehungen verloren
Indentation Punzonamiento Resteindruck		EN 433	≤ 0.10mm
Fire performance Reacción al fuego Brandverhalten		EN 13501-1 EN ISO 9239-1 EN ISO 11925-2	Class Bfl s1 ≥8kw/m ² pass Clase Bfl s1 ≥8kw/m ² conforme Klasse Bfl-s1 ≥8kW/m ² , bestanden
Chemical resistance Resistencia a los productos químicos Chemikalieneinwirkung**		EN 423	Good Buena beständig
Castor chair abrasion Huellas de sillas de ruedas Stuhlrollenbeanspruchung		EN 425	Pass Conforme geeignet
Under floor heating Calefacción por el suelo Fußbodenheizung		EN 12667	Suitable Apto geeignet
Electrical behaviours Características eléctricas Elektrisches Verhalten		EN 1815	≤ 2kV Antistatic ≤ 2kV Antiestáticas ≤ 2kV antistatisch
VOC emissions Emisiones de VOC VOC emissionen		prEN 15052 Section 01350 AgBB/DiBt	Low / Pass / Approved Baja / Conforme / Aprobado gering / geeignet / zugelassen

All Altro construction vinyl flooring contains bio-plasticiser and is phthalate-free.

* We recommend the use of Altro Aquarius™ for combined shoe and barefoot use in wet and dry areas such as hospital bathrooms and Altro Marine™ 20 / T20 for barefoot use in shower cubicles. Always check local regulations.

** Caution ketone / aromatic solvents. Please contact Altro for further technical advice regarding staining and chemical resistance. Certain chemicals may cause staining of vinyl. Traffic stain can be caused by oil residue, certain cleaning agents, asphalt and anti-oxidants in some types of rubber.

Installation and Maintenance

All installations in accordance with Altro safety flooring instructions and local codes of practice.

Please refer to Altro cleaning card for maintenance advice. Failure to install and maintain Altro flooring in accordance with installation instructions can affect its performance and slip resistance. Floors should be protected from other trades and thoroughly cleaned before handover.

All information is correct at the time of print and is subject to change without prior notice.

Visit us at www.altro.com for more information and updates.



Altro Limited a company certified by SGS to ISO 9001 and ISO 14001.



For further technical information please visit www.altro.com / www.asf.com.au
Si desea obtener más información técnica, visite www.altroscandess.com
Weitere technische Informationen finden Sie auf unserer Website www.altro.de

EN13845